

SEATTLE-TACOMA INTL (SEA)(KSEA) 10 S UTC-8(-7DT) N47°26.99' W122°18.71'

SEATTLE
H-1B, L-1D
IAP, AD

432 B LRA Class I, ARFF Index E NOTAM FILE SEA
RWY 16L-34R: H11900X150 (CONC-GRVD) S-100, D-230, 2D-600,

2D/2D2-1400 PCN 110R/B/W/T HIRL CL
RWY 16L: ALSF2. TDZL. PAPI(P4L)—GA 3.0° TCH 76'. RVR-TMR
0.6% down.

RWY 34R: MALSR. TDZL. PAPI(P4L)—GA 2.75° TCH 81'. RVR-TMR
0.8% up.

RWY 16C-34C: H9426X150 (CONC-GRVD) S-120, D-250, 2S-175,
2D-550, 2D/2D2-1120 PCN 96 R/B/W/T HIRL CL

RWY 16C: ALSF2. TDZL. PAPI(P4L)—GA 3.0° TCH 71'. RVR-TMR
0.6% down.

RWY 34C: MALSR. PAPI(P4L)—GA 3.0° TCH 73'. RVR-TMR Tree.
0.8% up.

RWY 16R-34L: H8500X150 (CONC-GRVD) S-100, D-216, 2D-448,
2D/2D2-1157 PCN 89 R/B/W/T HIRL CL

RWY 16R: ALSF2. TDZL. PAPI(P4R)—GA 3.0° TCH 69'. RVR-TMR
0.6% down.

RWY 34L: MALSR. PAPI(P4L)—GA 3.0° TCH 75'. RVR-TMR
0.8% up.

RUNWAY DECLARED DISTANCE INFORMATION

RWY 16C:TORA-9426 TODA-9426 ASDA-9426 LDA-9426
RWY 16L:TORA-11901 TODA-11901 ASDA-11901 LDA-11901
RWY 16R:TORA-8500 TODA-8500 ASDA-8500 LDA-8500
RWY 34C:TORA-9426 TODA-9426 ASDA-9426 LDA-9426
RWY 34L:TORA-8500 TODA-8500 ASDA-8500 LDA-8500
RWY 34R:TORA-11901 TODA-11901 ASDA-11901 LDA-11901

SERVICE: FUEL JET A, A1

AIRPORT REMARKS: Attended continuously. Bird flocks within arpt vcnty, check lcl advisories. Helicopters ldg and dep avoid overflying fuel farm lctd at the southeast corner of the arpt. ASDE-X in use. Opr transponders with altitude reporting mode and ADS-B (if equipped) enabled on all arpt surfaces. Do not mistake Twy T for ldg sfc. Twy A south of Twy G rstd to acft with wingspan 225' and smaller. Taxilane on N side of N satellite rstd to wingspan of less than 118'. Tri-taxilanes at N Satellite: Center (green) taxilane rstd to wingspan of 135' or less. When an acft is on the center (green) or other (orange/blue) taxilanes, no other acft can simultaneously use the adjacent taxilane(s). Orange and blue taxilanes are rstd to wingspans less than 118'. Two acft can simultaneously use the outer taxilanes. Taxilane W rstd to wingspan of 135' or less north of Twy N and 167' or less south to Twy N. Seattle ramp twr provides advsy ctl only. Access to air cargo 4 parking and cargo areas rstd to acft with wingspans of 170' or less. Twy for corporate hangar ramp ltd to acft with 62' or less wingspan for taxi ops. General aviation cstms parking is very ltd. Acft with wingspans of 171 ft or more parked at PAX gates or cargo 7 must provide 30 min PPR prior to pushback to Seattle ramp twr when vsby less than 2400 RVR. Only acft with less than 150' wingspan may exit Rwy 34R eastbound on Twy H. PPR for all GA PRKG and SVC. CTC 206-433-5481. OPR HRS 1330-0700Z†, with a call out AVBL upon REQ. 6 hr PPR for AVGAS fueling, ctc 206-433-5481. Btn the hrs of 0600-1500Z†, the use of extdd reverse thrust is discouraged byd what is necessary for opr or safety reasons. NS ABTMT procedures in effect btn 0600-1400Z†. For further info ctc SEA NS ABTMT office at 206-787-7496. Rwy status lgts are in operation. Ldg fee. General aviation ldg fees payable by major credit cards only. Flight Notification Service (ADCUS) avbl. NOTE: See Special Notices—Continuous Power Facilities, Seattle-Tacoma Intl Gatehold Procedures, Oceanic Departures.

AIRPORT MANAGER: (206) 787-5229

WEATHER DATA SOURCES: ASOS (206) 214-2592 WSP

COMMUNICATIONS: DnATIS 118.0 206-241-6025 UNICOM 122.95

Ⓡ **SEATTLE APP CON** 120.1 (199°-300°) 120.4 (301°-340° Rwy 34) 125.6 (West) 125.9 (301°-340° Rwy 16) (076°-160° Rwy 34) 126.5 (161°-198°) 133.65 (FINAL Rwy 16-34)


SEATTLE TOWER 119.9 (Rwy 16L-34R, Rwy 16C-34C) 120.95 (Rwy 16R-34L)

GND CON 121.7 **CLNC DEL** 128.0

Ⓡ **SEATTLE DEP CON** 119.2 (North Rwy 34R/34C/34L) 120.1 (199°-300°) 120.4 (301°-340° Rwy 34) (SOUTH 16L/16C/16R) 125.6 (West) 125.9 (301°-340° Rwy 16) (076°-160° Rwy 34) 126.5 (161°-198°)

CPDLC (LOGON KUSA) **RAMP CTL** 126.25 (Gate Hold) 126.875 (North Ramp) 122.275 (South Ramp)

AIRSPACE: CLASS B See VFR Terminal Area Chart svc; CLASS D.

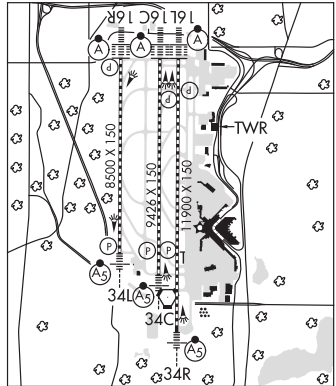

CONTINUED ON NEXT PAGE

CONTINUED FROM PRECEDING PAGE

VOR TEST FACILITY (VOT) 117.5

RADIO AIDS TO NAVIGATION: NOTAM FILE SEA.

(H) VORTACW 116.8 SEA Chan 115 N47°26.12' W122°18.58' at fld. 348/19E.

VOR unusable:

008°-023° byd 20 NM blo 3,500'
 008°-023° byd 30 NM blo 4,100'
 233°-273° byd 20 NM blo 8,000'
 233°-273° byd 30 NM blo 10,000'
 233°-273° byd 35 NM blo 11,000'
 233°-273° byd 8 NM blo 5,500'
 303°-333° byd 20 NM blo 2,900'
 303°-333° byd 30 NM blo 4,000'
 333°-353° byd 15 NM blo 3,500'
 353°-008° byd 20 NM blo 2,900'

DME unusable:

008°-028° byd 20 NM blo 4,500'
 008°-028° byd 30 NM blo 7,000'
 203°-219° byd 27 NM
 220°-225° byd 20 NM
 226°-239° byd 27 NM
 240°-253° byd 15 NM
 303°-008° byd 30 NM blo 3,500'

TACAN AZIMUTH unusable:

008°-163°
 303°-008° byd 30 NM blo 3,500'

ILS/DME 111.7 I-SZI Chan 54 Rwy 16C. Class IIIE. DME also serves Rwy 34C.

ILS/DME 110.3 I-SNQ Chan 40 Rwy 16L. Class IIIE. DME also serves ILS Rwy 34R. Possible Rwy 16L glideslope fluctuation on final when weather is 800/2 or better. Possible Rwy 16L glideslope fluctuation prior to DGLAS when weather is less than 800/2. Localizer unusable byd 15° left of course.

ILS/DME 110.75 I-CJL Chan 44(Y) Rwy 16R. Class IIIE. DME also serves ILS Rwy 34L.

ILS/DME 111.7 I-TUC Chan 54 Rwy 34C. Class IIE. DME also serves ILS Rwy 16C.

ILS/DME 110.75 I-BEJ Chan 44(Y) Rwy 34L. Class IIE.

ILS/DME 110.3 I-SEA Chan 40 Rwy 34R. Class IID. DME also serves ILS Rwy 16L. Poss Rwy 34R glideslope flctn on fa when wx is 800/2 or btr. Poss Rwy 34R glideslope flctn prior to BUCKK when wx is less than 800/2.

COMM/NAV/WEATHER REMARKS: Freq sectors float depending on rwy in use and sectors generally apply to Seattle TCA.

SEKIU (11S) 0 NW UTC-8(-7DT) N48°15.97' W124°18.84'

SEATTLE

355 B NOTAM FILE SEA

RWY 08-26: H2997X50 (ASPH) LIRL

RWY 08: Thld dsplcd 900'. Trees.

RWY 26: VASI(NSTD)—GA 4.0° TCH 35'. Tree.

SERVICE: LGT SS-SR.

AIRPORT REMARKS: Unattended. Deer on and invof arpt Sep-Mar. High ridge along N side of rwy. Turbulence on E end apch over water. Difficult apch when wind from N. Rwy 26 NSTD VASI 2 box VASI left side ngts only. Rwy 08-26 markings are faded.

AIRPORT MANAGER: (360) 417-3376

COMMUNICATIONS: CTAF 122.9

CLEARANCE DELIVERY PHONE: For CD ctc Seattle ARTCC at 253-351-3694.