

**LAKELAND**

**LAKELAND LINDER INTL** (LAL)(KLAL) 4 SW UTC-5(-4DT) N27°59.26' W82°01.14'

MIAMI  
H-8H, L-21D, 24F  
IAP, AD

142 B Class I, ARFF Index B NOTAM FILE LAL

**RWY 09-27:** H8499X150 (ASPH-GRVD) S-105, D-170

PCN 31 F/A/X/T HIRL

**RWY 09:** MALSR. PAPI(P4R)—GA 3.0° TCH 52'.

**RWY 27:** PAPI(P4L)—GA 3.0° TCH 45'.

**RWY 05-23:** H5005X150 (ASPH-GRVD) S-94, D-150

PCN 28 F/A/X/T HIRL

**RWY 05:** PAPI(P4L)—GA 3.0° TCH 56'.

**RWY 23:** PAPI(P4L)—GA 3.0° TCH 50'. Tree.

**RWY 08-26:** 2205X60 (TURF)

**RWY 08:** Thld dspcd 360'.


**RWY 26:** Thld dspcd 555'.

**LAND AND HOLD—SHORT OPERATIONS**

LDG RWY	HOLD—SHORT POINT	AVBL LDG DIST
<b>RWY 05</b>	09-27	2500
<b>RWY 09</b>	05-23	6000

**RUNWAY DECLARED DISTANCE INFORMATION**

<b>RWY 08:</b> TORA-1650 TODA-2010 ASDA-2205 LDA-1845
<b>RWY 09:</b> TORA-8499 TODA-8499 ASDA-8414 LDA-8414
<b>RWY 26:</b> TORA-1845 TODA-2205 ASDA-2205 LDA-1650
<b>RWY 27:</b> TORA-8499 TODA-8499 ASDA-8499 LDA-8499

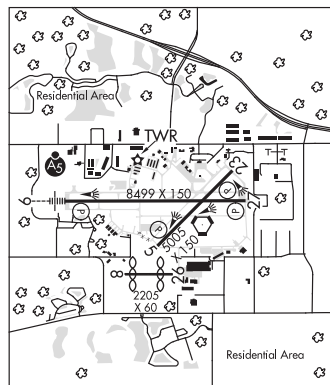

**SERVICE:** S4 **FUEL** 100LL, JET A **OX** 1, 2 **LG**TACTIVATE HIRL Rwy 05-23, HIRL Rwy 09-27 and MALSR Rwy 09—CTAF. PAPI Rwy 05, Rwy 09, Rwy 23, and Rwy 27 opr continuously. Twy D, Twy E, Twy F, Twy P unlgtd.

**AIRPORT REMARKS:** Attended 1100-0300Z±. Extv bird act on and infov arpt. Rwy 08-26 restricted to Group 1 acft under 1500 lbs MTOW, VFR daytime only, no touch and goes, PPR 863-834-4911. User fee arpt: PPR US CSTMS svc Thur-Mon; 1630-0100Z± call 863-647-4871 or 1-800-973-2867; after hours fee charged.

**AIRPORT MANAGER:** 863-834-3298

**WEATHER DATA SOURCES:** AWOS-3PT 118.025 (863) 834-2030. LAWR5.

**COMMUNICATIONS:** CTAF 124.5 ATIS 118.025 UNICOM 122.95

**RCO** 122.1R 116.0T (SAINT PETERSBURG RADIO)

Ⓡ **TAMPA APP/DEP CON** 120.65 119.9

**TOWER** 124.5 (1100-0300Z±) **GND CON** 121.4

**AIRSPACE:** CLASS D svc 1100-0300Z±; other times CLASS G.

**RADIO AIDS TO NAVIGATION:** NOTAM FILE LAL.

(H) **VORTAC** 116.0 LAL Chan 107 N27°59.17' W82°00.83' at fld. 134/1E.

TACAN AZIMUTH unusable:

321°-339° blo 6,000'

VOR unusable:

070°-100° byd 35NM blo 1,400'

**ILS/DME** 110.1 I-LAL Chan 38 Rwy 09. Class IE.

**SOUTH LAKELAND** (X49) 1 S UTC-5(-4DT) N27°56.00' W82°02.64'

MIAMI

110 NOTAM FILE PIE

**RWY 14-32:** 2412X100 (TURF)

**RWY 14:** Tree. Rgt tfc.

**RWY 32:** Tree.

**SERVICE:** S8 **FUEL** , UL94

**AIRPORT REMARKS:** Unattended/on call. Attended Sat-Sun 1200-dusk. Call arpt mgr 786-873-8283 for attendance. Ultralgt activity on infov arpt. No skydiving, pwr parachute or gyro ops without written permission from arpt owner. Rwy 14-32 ends not marked. Rwy 14-32 white pails outline landing strip. Thlds marked with 3 white pails perpendicular to cntrln. Arpt has no ngt time ops. Turf rwys may hold water after rain. Arpt is emerg evac site. Watch for emerg acft and vehicles on rwy and infov arpt. Rwy 14-32 road 97' to 100' south of centerline at full length of rwy.

**AIRPORT MANAGER:** 863-417-2177

**COMMUNICATIONS:** CTAF 122.9

**CLEARANCE DELIVERY PHONE:** For CD ctc Tampa Apch at 813-878-2528

**LEE CO** N26°31.79' W81°46.55' NOTAM FILE RSW.

MIAMI

(L) **VORTACW** 111.8 RSW Chan 55 073° 1.2 NM to Southwest Florida Intl. 25/2W.

H-8H, L-21D, 23A, 23B